
Steel

Clamping bolts

upward axial clamping





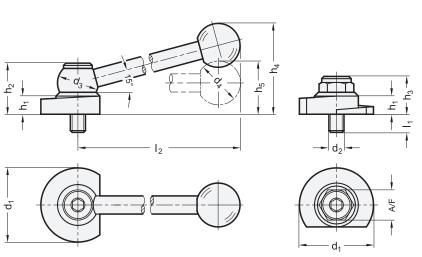



Type

- **KV** with ball lever, angular (serration)
- **GV** with ball lever, straight (serration)
- SK with hexagon

Clamping direction

- R by clockwise rotation (drawn version)
- L by anti-clockwise rotation

1

$d_1 - 0.5$	d ₂	d ₃	d_4	h ₁	h ₂	h ₃	h₄ ≈	h ₅	I ₁	I ₂ ≈	A/F
40	M 8	24	25	10	31	21	55	31	8	100	15
50	M 10	28	30	12	34,5	24	62	36	11	116	19

Specification

• GN 918.1

Steel

- blackened
- Eccentrical cam and washer case hardened
- Screw bolt nitrided
- Tensile strength class 8.8 (800 N/mm²)

• GN 918.6

Stainless Steel

- Eccentrical cam AISI 303
- chemically nickel plated
- Screw bolt and washer AISI 630 tempered
- Ball lever (Type KV) AISI 303

matt shot-blasted

This information applies to both standards:

- Ball knob DIN 319 Plastic Duroplast black, shiny finish
- Stainless Steel characteristics → Page 1489
- RoHs compliant

Information

Clamping bolts GN 918.1 / GN 918.6 have a circumferential wedge surface, allowing the rapid and safe clamping and releasing at a relatively large adjustable range and with high clamping force. Owing to the small pitch angle (wedge angle), the eccentric cam is self-arresting.

The ball lever is linked with the clamping bolt via a serrated ratchet, allowing the adjustment of the most suitable clamping position or the "readjustment" of the handle.

Screw bolt and washer (see technical instructions) are matched to ensure that the clamping bolt can be easily turned after tightening. Using a washer requires no special requirements in terms of the threaded hole design. This means it can also be mounted on tables using T grooves.

Clamping bolts have the advantage that they can be turned after releasing in the clamping zone.

The use of GN 605 ball point screws with flattened ball is recommended in connection with the clamping bolts. → Page 782

see also...

Technical instructions → Page 473

How to order (Steel)	1	d ₁
1 2 3 GN 918.1-50-KV-R		Туре
		Clamping direction
How to order (Stainless Steel)		
How to order (Stainless Steel)	1	d ₁
How to order (Stainless Steel)	1 2	d₁ Type